

Determination of power supply efficiency


## Accurate efficiency measurement is of interest to the customers



Bernhard Erdl | Founder, President and Chief Developer

Modern power supplies are characterised by ever higher efficiencies. But can customers actually rely on the efficiency specifications listed in datasheets provided by the manufacturer? How were the values determined?

Can the customer measure such a thing by himself and what would he have to consider?

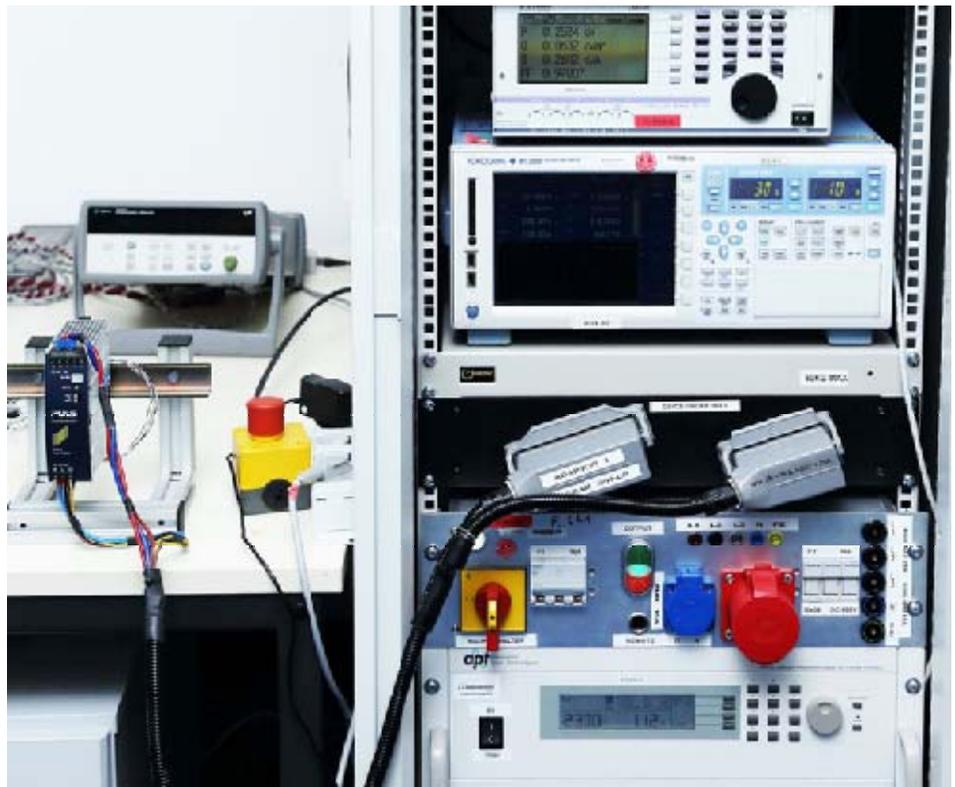

More and more customers are realising that the efficiency of a power supply has a direct influence on reliability. It is essential – especially in the case of convection-cooled devices – on the one hand for a small and on the other hand a reliable power supply. Without forced ventilation, heat can only be dissipated to a limited degree and the designer of a power supply must be very careful to achieve the lowest possible generation of heat. Even the other essential system elements benefit from low power losses

and therefore also minimal heat generation. An ever increasing number of power supply manufacturers thus strive for high efficiency. This article should help users determine the accurate efficiency and thus the power losses of a power supply so that they don't have to rely completely on data sheets with often optimistic and scarce information.

The following **five recommendations** should be given highest priority when measuring efficiency and have proved to be indispensable in practice. They are explained in more detail in this paper.

- Use **precision meters**: If possible, power analysers or highly accurate wattmeters
- Ensure **proper cabling** when setting up the measurement and that you are measuring the correct voltage
- When taking AC measurements, always use an **electronic AC source** if available
- **Avoid EMC interference** from the device under test
- Consider **temperature** and **time influences**

### Minimum efficiency changes produce plenty of influence on no-load losses

Efficiency is a figure that helps one carry out a proper comparison of different power supplies. However, system designers and users of power supplies are even more interested in the heat which remains in the power supply – i.e. the power losses. Since these power losses cannot be electrically measured in a direct manner, one can only consider the difference between input and output power.

Nowadays, efficiency values lie at around 95% – this corresponds to a loss of 5%. However small measurement errors in the input and output power lead to large errors when calculating power loss: If there's a measurement error of just 0.5%, i.e. a total of 1%, the power loss calculation would be wrong by 20%. (See diagram 1)

It is also important to keep in mind that seemingly small differences in efficiency mean a big difference in power losses. The values for modern power supplies lie between 92 and 95%. The user might have the impression that one or two percent of difference wouldn't play a big role. However, this is a misconception. Because it is not the absolute value of efficiency but rather the difference from the ideal value of 100% what matters most.

An example for well-comparable power supplies with 48V / 5A output: The PULS QS10 introduced in 2005 has an efficiency of 92.0%. 10 years later, the PULS CP10 is available with an efficiency of 95.5%. At first glance, the difference of „just“ 3.5% doesn't seem to be a big improvement. However, the power losses of the CP10 have been reduced by 41% when compared to the QS10 model.


This means that at high efficiencies, even small increases produce a significant reduction in no-load losses. With increasing efficiencies, measurement accuracy keeps gaining importance, as otherwise it would be impossible to determine no-load losses properly.

### Determining efficiency accurately and avoiding errors

The closer the developer gets to that perfect efficiency of 100%, the harder it becomes to measure accurately. Absolute measurement precision is therefore essential to give an accurate statement about no-load losses in a power supply. However, many errors could be avoided by good preparation and professional measurement. The most common sources of error are:

- Incorrect measurement principle due to unsuitable meters
- Inaccurate meters
- Faulty measurement setup
- Neglecting environmental conditions

A whitepaper about the topic, titled „Accurate Efficiency Measurements“, is currently in its final stages. This was prepared by the Technical Committee of the European Power Supply Manufacturers Association ([EPSMA, www.epsma.org](http://www.epsma.org)), and above all by the members PULS, Artesyn Embedded Power and Efore.

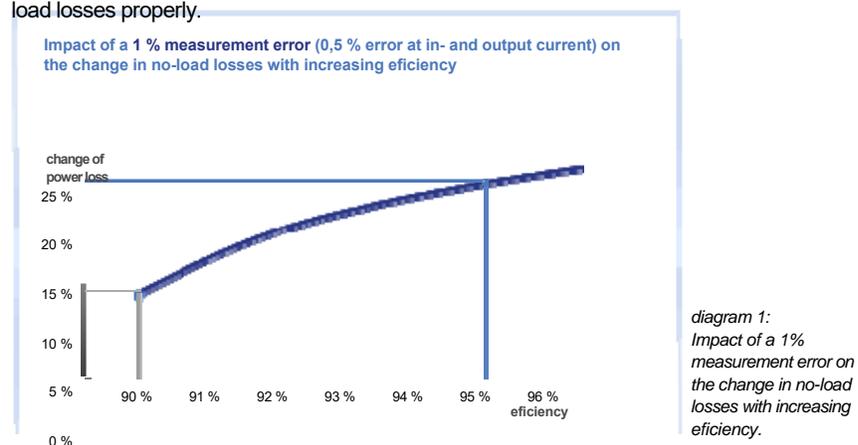

## Multimeter, wattmeter or power analyser – which is the (measurement) tool of choice?

There are a number of measuring instruments which are used for the determination of efficiency. Nevertheless, the measurement tolerances and the capabilities of measuring instruments in measuring various signals (AC or DC) varies considerably.

**Multimeter:** Accurate multimeters do a great job measuring the voltage and current of purely DC inputs and outputs. The voltage can be measured with high precision directly at the input and output of the power supply. Many multimeters also have built-in ability to measure current, but this is usually too inaccurate (inaccuracy of 1% or more) or it does not have sufficient measuring range (usually limited to 10A). Instead, the current should be measured by high-precision shunt resistors with 0.01% tolerance. However, the non-synchronous detection of values can be problematic because it leads to errors if fluctuating conditions are present.

**Data loggers** are even better for DC measurements. They consist of a single, usually highly accurate meter, which is used several times by multiplexing. In the same measuring range, the errors even cancel off each other and all values can be promptly recorded and evaluated quickly with a spreadsheet.

However, **AC input power** cannot be measured with multimeters or data loggers. It is a common mistake to assume that it is sufficient to measure the true RMS of the current and voltage and to multiply the two values to determine the input power. This calculation, however, determines the apparent power and not the real power which is crucial for the power losses. The measurement of AC

input power, even with True RMS multimeters, thus gives incorrect measurements and is an absolute no-go!

**Wattmeters:** Watt meters are used for measuring AC signals and follow the right principle. The instantaneous values of current and voltage are multiplied and a mean value is calculated from these products – this corresponds to the physical definition of performance. However, most simple wattmeters have a high measurement inaccuracy (around 1%). Moreover, frequently changing input or output currents (AC input, varying output load) cause additional measuring errors. Fluctuating values are thus difficult to interpret. Generally, only high-precision watt-meters should be used when measuring efficiency.

**Power analyser:** PULS uses power analysers to measure the efficiency of its power supplies. (See image 1) The advantages of this are the high basic accuracy of 0.02%, the correct measuring of active power, the simultaneous and thus synchronous measuring of input and output, and the direct display of power losses and efficiency. The downside of this method of measuring is the high purchase price involved. Nevertheless, the power analyser is the tool of choice for the accurate determination of efficiency.



image 1:  
The efficiency of PULS switch-mode power supplies is measured with ultra-modern power analysers.

## Avoiding mistakes in the measurement setup

A precise and expensive power analyser may however not provide accurate results if mistakes were made during the measurement setup.

**Correct wiring:** All power losses that do not come from the device under test are not allowed to be included in the measurement! This is the main principle, when it comes to correct wiring in the measurement setup. Because every cable and every contact resistance causes additional power losses that may distort the measurement results. A proper four-pole measurement (Kelvin measurement) must have separate cables for the measurement of current and voltage.

(See image 2)



image 2:  
It is imperative to have the correct wiring. A proper four-pole measurement (Kelvin measurement) must have separate cables for the measurement of current and voltage.

**Voltage source:** Simple DC voltage supplies are sufficient for switch-mode power supplies with DC-input. For AC measurements, it is important to know that the internal resistance of the voltage source influences the measurement through the curve shape of the mains sine. In a 240W power supply without PFC, a difference of 0.4% was measured between the soft power from an isolating regulating transformer and the hard power from an electronic AC source. This gives the most reproducible values and is therefore preferable.



This Document has been created with a trial version of deskUNPDF. To purchase a copy of deskUNPDF and remove the trial restrictions, please visit [www.docudesk.com](http://www.docudesk.com) or email [sales@docudesk.com](mailto:sales@docudesk.com) for assistance.